



Firmware for TN-4900 Series Release Notes

Version: v3.14	Build: 24123112
Release Date: Jan 07, 2025	

Applicable Products

TN-4900 Series

Supported Operating Systems

N/A

New Features

NA

Enhancements

- Added support for "Route Mode" in IPsec Startup Mode. In Route Mode, the VPN tunnel initiates only when routing packets are generated, relying on traffic to trigger the tunnel.
- Added support for CLI commands to configure MXsecurity port settings.
- The "Ping Response" function has been moved from the "User Interface" (MX-ROS v3.12.1 to v3.13) and "Trusted Access" (MX-ROS v3.6) pages to the dedicated "Ping Response" page.
- Added IP display on the Querier Connected Port in the IGMP Snooping Group Table.

Bugs Fixed

- Routed traffic is not correctly processed according to the configured QoS rules.
- When exporting the configuration, the Object IP Range setting is saved incorrectly, causing importing the configuration to fail.
- MXview 1.4.1 does not receive encrypted SNMPv3 Trap/Inform packets from the routers.
- 4, ARP Reply packets are being unintentionally dropped in Bridge mode.
- Email Settings cannot be disabled.
- After changing the Management VLAN, the router is unreachable when pinged.
- When configuring Bridge members, the system unintentionally creates two untagged VLANs under the access port.
- CVE-2024-9138, CVE-2024-9140 vulnerability issues. For more details, search the Security Advisories section on the Moxa website for the following Security Advisory ID: MPSA-241155.

Changes

- Changed the QoS DSCP Mapping table to start from 0x0(0) instead of 0x0(1).

Notes

- Due to an issue, using an identical pre-shared key to set up multiple site-to-any IPsec VPN tunnels with IKEv1 mode requires a workaround. Please contact Moxa Technical Support for assistance.
- When switching between Port-based and Zone-based Bridge mode, disable the currently active mode before configuring the intended mode to avoid issues.

Version: v3.13	Build: 24100800
Release Date: Oct 09, 2024	

Applicable Products

TN-4900 Series

Supported Operating Systems

N/A

New Features

- Added support for the Loopback Interface function.
- Added support for event-triggered actions to the VRRP function.
- Added support for UDP-Flood to the DoS Policy function.
- Added SNMP Trap as a Log Destination for the Layer 2 Policy function.
- Added support for additional event log export formats: .pdf, .csv.
- Added a CPU usage threshold alarm to the Event Notifications function.
- Added a port usage threshold alarm to the Event Notifications function.
- Added support for Step7 Comm+, OPC UA, and MELSEC to the Advanced Protection function.
- Added support for save and restore to the Custom Default function.
- Added support for the DNS Server function in Network Service.

Enhancements

- Enhanced the following IPsec algorithms:
 - Encryption: AES-256-GCM
 - Hash: SHA-512
 - DH Group: DH15 (modp3072), DH16 (modp4096), DH17 (modp6144), DH18 (modp8192), DH22 (modp1024s160), DH23 (modp2048s224), DH24 (modp2048s256), DH31 (curve25519)
 - PRF: PRF SHA-256, PRF SHA-384, PRF SHA-512
- Added a syslog option for VRRP State Change notifications.
- A detailed log message will now be recorded when importing a configuration fails.
- Supported Multiple Static Multicast Route Rules can be created with the same group address & outbound interface but different inbound interfaces.
- Added support for DHCP error logs in Event Notifications.
- Added support for IGMP Snooping error log in Event Notifications.
- Added support for the TRDP protocol to the Advanced Protection function in the CLI.
- Added support for RFC 5424 format for syslog messages.
- Added support for Default Action Log to the Layer3-L7 Policy function.

Bugs Fixed

- The "Login Authentication Failure Message" does not save properly.
- Using the newline character (\n) in the 'Login Message' and 'Login Authentication Failure Message' causes abnormalities in the output.
- The system is unable to ping the VRRP virtual IP.
- Users are able to bypass password policy violation warnings by pressing ESC on the keyboard.
- Time zone settings are not saved if GMT is set to 0.
- Port-based DHCP provides the same IP if those ports are member ports of a created bridge interface.
- RSTP is not functioning correctly over VLAN trunk ports.
- RSTP on VLAN trunk ports is causing a dual root device situation.
- Only one static multicast address can be configured at a time using the CLI or web import.
- SNMP OID returns an additional "\n" character.
- NAT is not working after reboot.
- op-up window will stay after auto logout.



- CVE-2024-6387 vulnerability issue. For more details, search the Security Advisories section on the Moxa website using the following Security Advisory ID: MPSA-246387.
- CVE-2024-9137, CVE-2024-9139 vulnerability issues. For more details, search the Security Advisories section on the Moxa website using the following Security Advisory ID: MPSA-241154.
- CVE-2024-1086 vulnerability issue. For more details, search the Security Advisories section on the Moxa website using the following Security Advisory ID: MPSA-249807.

Changes

- Changed the IPS license expiration behavior: When the license expires, IPS functionality will remain enabled, but IPS patterns will no longer be updated.
- Changed the Trusted Access behavior: Trusted Access now applies to the Web UI, CLI, and New Moxa Command interfaces.
- Changed the Preempt Delay range for the VRRP function from 10 to 300 to 0 to 300.
- Changed the maximum password and shared key length to 64 characters.
- The password and shared key now support special characters.

Notes

- If you encounter unexpected behavior with ECSP control packets, try disabling the Trusted Access Function first. If the issue persists, please contact the MOXA Technical Support team.